

AD-A031 680

ARMY AVIATION TEST BOARD FORT RUCKER ALA  
EVALUATION OF CONSOLIDATED DIESEL ELECTRIC CORPORATION OIL SERV--ETC(U)  
SEP 62

F/G 1/5

UNCLASSIFIED

STEBG-S-AVN-3662


NL

| OF |  
AD  
A031680



END

DATE  
FILMED  
12-76

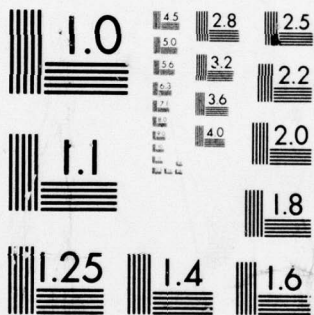

MICROCOPY RESOLUTION TEST CHART  
NATIONAL BUREAU OF STANDARDS-1963-A

ADA031680

UNITED STATES ARMY AVIATION BOARD  
Fort Rucker, Alabama

14  
STEBG-S-AVN-3662

SUBJECT: Report of Test, Project No. AVN 3662, Evaluation of  
Consolidated Diesel Electric Corporation Oil Servicing  
Dispenser.

6 10 SEP 1962

11 10 Sep 62

12 10p.

TO: Commanding General  
U. S. Army Test and Evaluation Command  
ATTN: AMSTE-BG  
Aberdeen Proving Ground, Maryland

DDC

NOV 8 1976

1. AUTHORITY.

a. Line Item No. F-812, Annex F, USCONARC Pamphlet  
No. 705-1, as changed.

b. Purpose. The purpose of this test was  
To conduct an evaluation of the Consolidated  
Diesel Electric Corporation Oil Servicing Dispenser to determine its  
suitability for Army use.

2. BACKGROUND.

a. The following paragraph 512e(3) is found in "General  
Objectives", Combat Development Objectives Guide, Change 3,  
1 December 1960; "Development of aircraft accessory and supporting  
equipment and facilities should keep pace with improvements in major  
items of equipment. A continuing effort must be made to insure that  
essential maintenance and support equipment is air transportable to  
support fast moving situations. . . . Improved reliability and increased  
utilization of aircraft through advanced maintenance techniques and  
equipment is required . . . ."

b. The first prototype oil dispenser was developed for the  
United States Army Transportation Corps by Consolidated Diesel  
Electric Corporation and was evaluated during the period June - July

Approved for public release;  
distribution unlimited.

036500

LB

FOR OFFICIAL USE ONLY  
REMOVAL OF PROTECTIVE MARKING CANNOT BE PREDETERMINED

JE Malloy  
USAAVNB  
5 DEC 69  
AR 342-16

SUBJECT: Report of Test, Project No. AVN 3662, "Evaluation of Consolidated Diesel Electric Corporation Oil Servicing Dispenser"

c. The Transportation Corps Army Air Support Equipment Evaluation Group requested that USCONARC perform user test on one of two additional modified units also developed by Consolidated Diesel Electric Corporation.

e. The dispenser was received from Consolidated Diesel Electric Corporation on 27 March 1962, and testing begun on 28 March 1962. A maintenance package was not received. A draft operation and maintenance instructions handbook was received.

4. TESTS. The oil servicing dispenser was evaluated by Aviation Board personnel during the period, 28 March - 30 July 1962. Outside air temperatures ranged from 64°F. to 93°F. HU-1, H-21, H-37, AO-1, YAC-1, L-20, U-1, L-23, YL-26, L-28, and T-28 aircraft were serviced with the unit during this period.

ADMISSION fee  
#715  
DOB  
CARRINGTON  
MONTANA  
BY  
ENTRANCE  
LIVE  
A

2

~~FOR OFFICIAL USE ONLY~~

DDC  
NOV 8 1976



STEBG-S AVN 3662

SUBJECT: Report of Test, Project No. AVN 3662, "Evaluation of Consolidated Diesel Electric Corporation Oil Servicing Dispenser"

a. Physical Characteristics.

(1) The unit measured 77 inches wide, 96 inches long, and 55 inches high. It weighed 1690 pounds empty and 2750 pounds filled to capacity.

(2) The unit was sufficiently rugged for movement over rough terrain. However, towing at speeds over 10 m.p.h. on rough terrain and 20 m.p.h. on roads was not permitted.

b. Operational Characteristics.

(1) The dispensing nozzles were compatible with the aircraft serviced during the test. The dispensing gauges could not be seen by the operator during servicing; however, this was corrected by installing gauge-type nozzles.

(2) The rate of flow of oil was satisfactory under the temperature range encountered during this test. No problems attributable to climatic conditions were encountered. The filters were adequate to prevent oil contamination.

(3) The controls were adequate except that the main shut-off valve for the interconnected tanks was not readily accessible.

(4) The power sources were satisfactory except as noted below:

(a) The location of the gasoline-engine choke control required the operator to reach over the exhaust pipe.

(b) The hand crank forward-storage-position clamp chafed the lower cowling of the starter recoil assembly.

(5) The gasoline oil-heating unit was not safety-placarded to the effect that it should not be used in the vicinity of aircraft.

STEBG-S AVN 3662

SUBJECT: Report of Test, Project No. AVN 3662, "Evaluation of Consolidated Diesel Electric Corporation Oil Servicing Dispenser"

c. Personnel.

(1) The dispenser could be operated by one man and no special skills were required. Personnel could be taught to operate and maintain the unit in approximately two hours.

(2) The handbook provided by the manufacturer was inadequate in that detailed instructions were not provided.

d. Tactical Suitability.

(1) No difficulty was encountered in servicing aircraft. The addition of a lightweight ladder to the unit would aid materially in servicing some of the larger aircraft where access to the oil inlet is difficult.

(2) No difficulty was encountered in filling or maintaining the unit.

(3) The operational portion of the unit was found to be sufficiently rugged to withstand simulated tactical operations. However, since the undercarriage was designed under the Military Specification Group for vehicles intended for operation at fixed installations and on hardstand surfaces, the mobility of the unit was unsatisfactory for tactical use. While the unit could be transported by an Army 2 1/2 ton truck and towed by standard Army vehicles, the small wheels, limited speeds, and lack of standard vehicle lights and brakes severely limited handling in mud and over rough terrain, and precluded safe towing in convoy at normal speeds.

(4) The unit was transported externally by H-34, and its size and weight indicate it could also be carried by the following aircraft:

(a) As an internal load:

1. AC-1

2. H-37

STEBG-S AVN 3662

SUBJECT: Report of Test, Project No. AVN 3662, "Evaluation of Consolidated Diesel Electric Corporation Oil Servicing Dispenser"

3. HC-1

(b) As an external load:

1. H-37

2. HC-1

3. H-21

4. HU-1B

5. HU-1D

(5) The towing bar has an excessive amount of play at the vertical hinge joint resulting in excessive swaying while being towed.

f. Maintenance.

(1) Organizational maintenance could be performed by one man. The following problems were encountered:

(a) Gasoline-engine oil filler neck could not be serviced through the access door.

(b) Grease fittings on the single-tank dispensing pump were inaccessible.

(c) Gasoline-engine spark-plug lead wire chafed on the fly wheel cowling and the engine cylinder head.

(d) The "V" belt from the d. c. motor and the engine-driven clutch to the dispensing pumps could not be adjusted.

(e) The nuts on the engine and motor mountings were not secured to the frame, necessitating removal of the dispenser unit from the trailer to change the engine or the motor.



STEBG-S AVN 3662

SUBJECT: Report of Test, Project No. AVN 3662, "Evaluation of Consolidated Diesel Electric Corporation Oil Servicing Dispenser"

(2) After two major breakdowns, the unit was returned to serviceable condition by factory personnel. These breakdowns consisted of:

(a) Failure of the gasoline engine fuel tank support bracket and oil drain pipe.

(b) Failure of the electric motor output shaft.

5. FINDINGS. This paragraph includes all deficiencies and those shortcomings which are considered significant enough to warrant corrective action.

a. Deficiencies. The following deficiencies require elimination in order to make the item acceptable for use on a minimum basis.

<u>DEFICIENCY</u>	<u>SUGGESTED CORRECTIVE ACTION</u>	<u>REMARKS</u>
The mobility of the present trailer is unsatisfactory for tactical use. The trailer conforms to MIL Spec. for Mobility Type II, Mobility Group C as outlined in MIL-M-8090.	For tactical suitability, conform to MIL Spec. for Mobility Type III as outlined in MIL-M-8090.	Consideration should be given to mounting the dispensing unit on the proposed Multi-Purpose Trailer and Pallet System being developed by USATRECOM (reference f).

b. Shortcomings. The following shortcomings should be corrected, if it can be done without unduly complicating the item or inducing another undesirable characteristic, either concurrently with elimination of deficiencies in paragraph 5, or in production engineering or by product improvement.



STEBG-S AVN 3662

SUBJECT: Report of Test, Project No. AVN 3662, "Evaluation of Consolidated Diesel Electric Corporation Oil Servicing Dispenser"

<u>SHORTCOMINGS</u>	<u>SUGGESTED CORRECTIVE ACTION</u>	<u>REMARKS</u>
1. Gasoline engine oil filler neck is on the rear of the engine and cannot be serviced through the access door.	Reposition filler neck to afford easy servicing.	
2. Gasoline engine choke control is on the rear of the engine, requiring operator to reach over exhaust pipe.	Route to front for easy and safe access.	
3. Grease fittings on the single tank dispensing pump are inaccessible.	Provide access hole for ease of lubrication.	
4. Gasoline engine spark plug lead wire chafed on the fly wheel cowl and the engine head.	Provide an access hole with rubber grommet for lead wire.	
5. The hand crank forward storage position clamp chafed the lower cowl of the starter recoil assembly.	Reposition clamp.	
6. The portable gasoline heater is not safety placarded.	Placard both heater and heater access hole.	
7. The tow bar eye is too large for the standard tug pintle, but is satisfactory for the tactical vehicle pintle.	Provide a standard towing eye.	

STEBG-S AVN 3662

SUBJECT: Report of Test, Project No. AVN 3662, "Evaluation of Consolidated Diesel Electric Corporation Oil Servicing Dispenser"

<u>SHORTCOMINGS</u>	<u>SUGGESTED CORRECTIVE ACTION</u>	<u>REMARKS</u>
8. The "V" belt from the clutch to the dispensing pumps has no provision for adjustment.	Provide a means of adjustment.	
9. The main shutoff valve for the interconnected tanks is not readily accessible.	Reposition shutoff valve.	
10. The filter for the interconnected tank is blocked by the single tank tubing from the instrument panel.	Reroute tubing.	
11. The towing bar has an excessive amount of play at the vertical hinge joint.	Provide a bushed, minimum tolerance joint.	
12. The nuts on the engine and motor mountings are not secured to the frame. This necessitates removal of the unit from the trailer to change engine or motor.	Provide a holding union for these nuts.	
13. Excessive engine vibration due to faulty governor adjustment caused damage to the engine fuel tank support bracket and engine oil drain pipe.	Provide adequate adjustment instructions in the handbook.	

STEBG-S AVN 3662

SUBJECT: Report of Test, Project No. AVN 3662, "Evaluation of Consolidated Diesel Electric Corporation Oil Servicing Dispenser"

6. CONCLUSIONS.

a. The Consolidated Diesel Electric Corporation Oil Servicing Dispenser, as tested, is not suitable for tactical Army use.

b. Mounting the dispensing unit on the proposed Multi-Purpose Trailer and Pallet System, or a similar trailer, should make the item suitable for tactical Army use.

c. The Oil Servicing Dispenser offers sufficient potential to warrant further consideration for Army use.

7. RECOMMENDATIONS. It is recommended that:

a. The deficiency and shortcomings listed in paragraph 5 be corrected.

b. The modified unit be returned to this Board for check test.

8. REFERENCES.

a. Minutes, 5th Meeting, Transportation Corps Air Support Equipment Evaluation Group, 5, 6, 7 December 1961, held at U. S. Army Transportation Aircraft Test and Support Activity, Fort Rucker, Alabama.

b. End of Test Report, Project No. K-610405, Task No. K-20, "Test Report of Oil Dispensing Unit," 19 September 1961, Headquarters, U. S. Army Transportation Aircraft Test and Support Activity, Fort Rucker, Alabama.

c. Disposition Form, ATBG-ACAB, U. S. Army Aviation Board, 9 February 1962, subject: "Oil Servicing Dispenser."

d. Plan of Test, Project No. AVN 3662, "Evaluation of the Consolidated Diesel Electric Oil Servicing Dispenser," U. S. Army Aviation Board, 14 May 1962.




STEBG-S AVN 3662

SUBJECT: Report of Test, Project No. AVN 3662, "Evaluation of Consolidated Diesel Electric Corporation Oil Servicing Dispenser"

e. Letter, ATBG-SEC AVN 3662, U. S. Army Aviation Board, 21 June 1962, subject: "Plan of Test, Project No. AVN 3662."

f. Agenda Item 61-500/002/2, Minutes of the Fifth and Sixth Meetings, Transportation Corps Army Air Support Equipment Evaluation Group, held 5, 6, 7 December 1961 and 13, 14, 15 March 1962, at the U. S. Army Transportation Materiel Command, St Louis, Missouri.

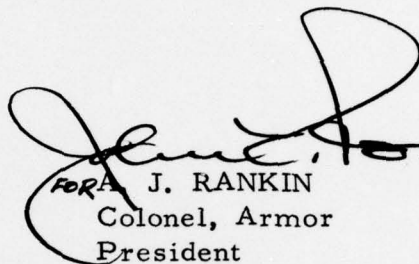 Lt Col  
FOR J. RANKIN  
Colonel, Armor  
President